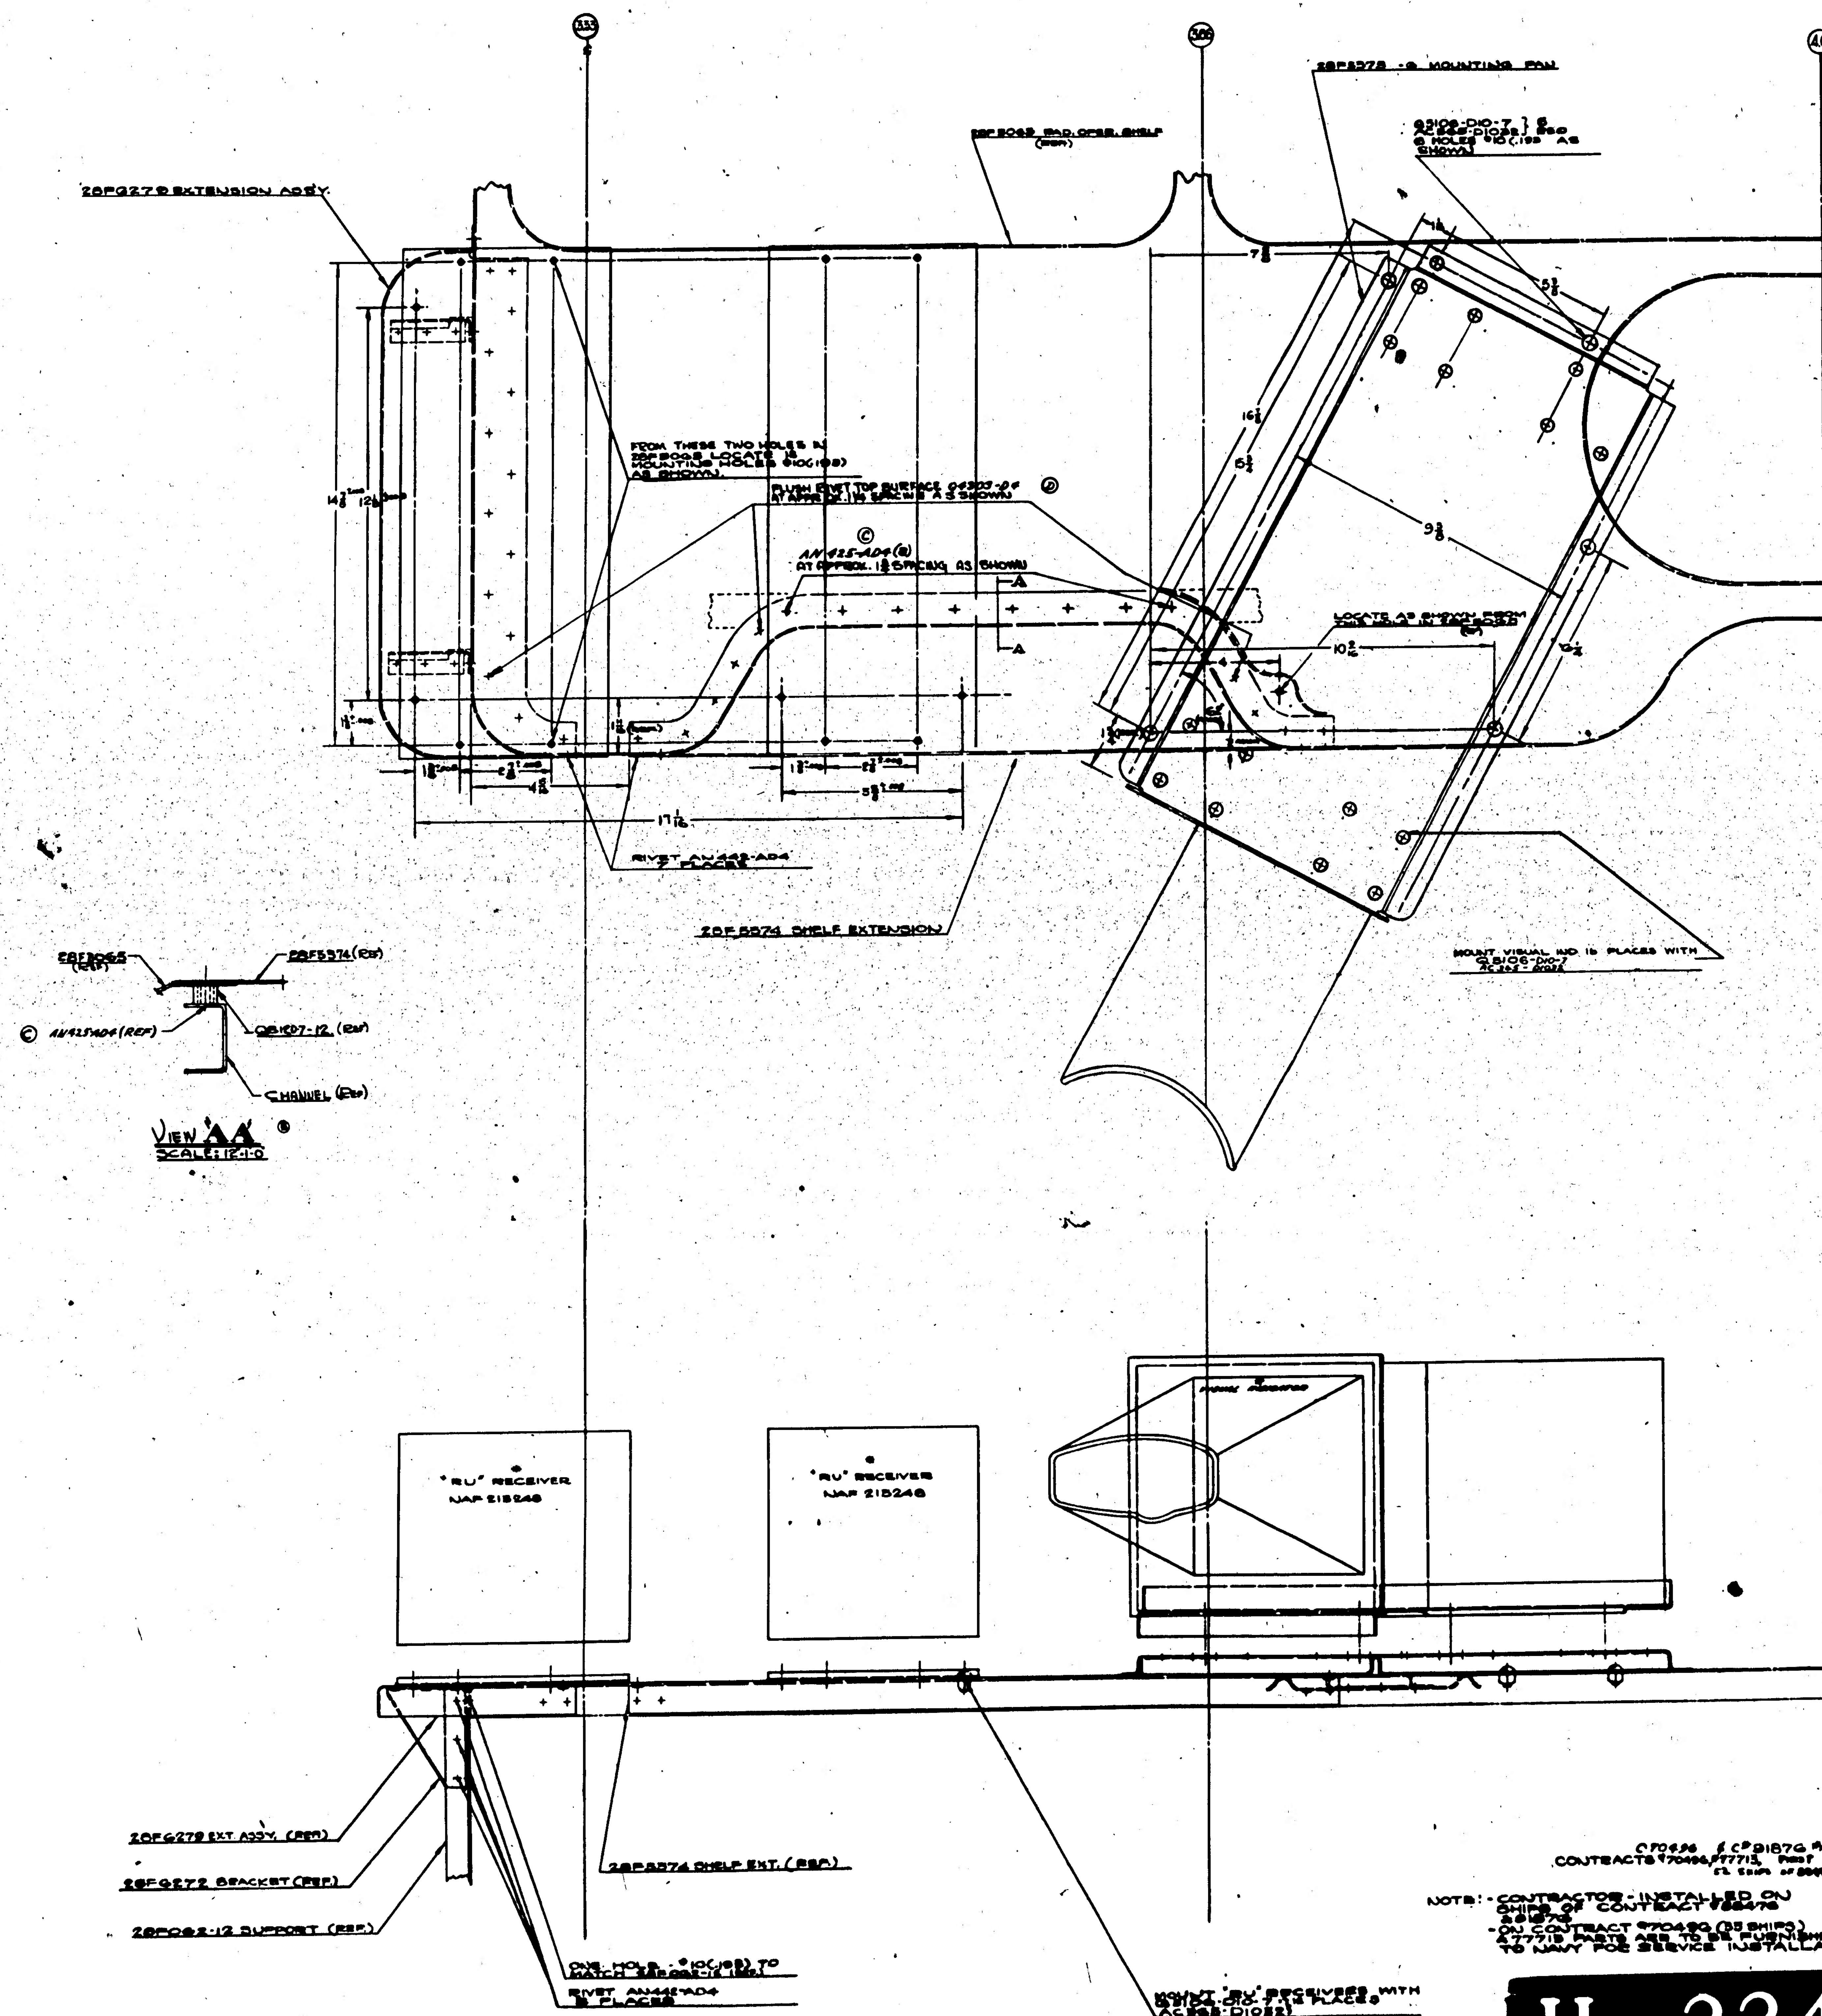


REV.	ALTERATION	DATE	BY	REV.	ALTERATION	DATE	BY
				A	[illegible] - RELEASE	[illegible]	[illegible]
				B	REPLACED AN425-AD4 RIVETS	[illegible]	[illegible]
					[illegible] AC365-D1032 & Q8507-12		
					ON 28F5374 ATTACHMENT		
					-REMOVE 28F5375 & AN442-AD4		
					ATTACHING RIVETS		
					-RE-LOCATE 28F5373-6		
					PAN & MOUNTING HOLES		
					-ADDED VIEW "A-A"		
					-REVISED "B.M." TO CONFORM		
				C	-REPLACED (.193) HOLE (8),		
					Q5106-D10-12 (8), AC365-		
					D1032 (8) & Q8512-8-24F (8)		
					WITH AN425-AD4 (8) (WT. CHG. NEG.)	[illegible]	[illegible] PER E.O. A31930
				D	IN NOTE "FLUSH --- SHOWN"		
					Q4303-D4 WAS AN425-AD4		
					(WT. CHG. NEG.)	[illegible]	[illegible]

PART NO.	STOCK	MATERIAL	SPEC.	QTY
Q5106-D10-7				24
AC365-D1032				24
AN442-AD4				
AN425-AD4				
Q8512-D7-12				8
Q4303-D4				
*S.I.S. 26690 TYPE "B" INSTRUMENT CHASSIS				1
*S.I.S. 2668 MOUNTING BASE				1
*S.I.S. 2665 TYPE G UNIT INDICATOR				1
*VISUAL INDICATOR				
*"RU" RECEIVER - NAF 215246				2
28F6279 SHELF EXTENSION ASSY.				1
28F5374 SHELF EXTENSION				1
28F5373-6 MOUNTING PAN				1

* GOVERNMENT FURN.

Rush released 2-26-42

C70496 & CP91876 N/P 90
CONTRACTS 70496, 77713, FIRST 52 SHIPS OF 80496

NOTE: - CONTRACTOR - INSTALLED ON SHIPS OF CONTRACT 68476 & 91876
- ON CONTRACT 70496 (35 SHIPS) & 77713 PARTS ARE TO BE FURNISHED TO NAVY FOR SERVICE INSTALLATION

	MODEL	NEXT ASSY.	QTY.
-0	PBY-5	28F1082	1
-0	PBY-5A	28F2496	1

REQUIREMENTS PER AIRPLANE

PARTS LIST FOR ASSY. — -0, -2, -3, -4, -5

H 334

[redacted]

HEAT TREAT: NONE — FINISH: NONE

NAME: INSTALLATION - FURN. - "RU" RECEIVERS & RADIO OPERATOR'S VISUAL INDICATOR

CONSOLIDATED AIRCRAFT CORP. — SAN DIEGO, CALIF.

J 28F5372